

#### UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

REGION 5 77 WEST JACKSON BOULEVARD CHICAGO, IL 60604-3590

REPLY TO THE ATTENTION OF:

AUG 1 8 2015

### CERTIFIED MAIL 7009 1680 0000 7648 7542 RETURN RECEIPT REQUESTED

Ms. Tonya Powell
Safety Team Leader
Chicago Tribune – Freedom Center
77 West Chicago Avenue
Chicago, Illinois 60610

Re: Notice of Violation Compliance Evaluation Inspection ILD 045 304 367

Dear Ms. Powell:

On July 16, 2014 a representative of the U.S. Environmental Protection Agency inspected the Chicago Tribune – Freedom Center facility (Tribune) located in Chicago, Illinois. As a large quantity generator of hazardous waste, the Tribune is subject to the Resource Conservation and Recovery Act, 42 U.S.C. § 6901 *et seq.* (RCRA). The purpose of the inspection was to evaluate the Tribune's compliance with certain provisions of RCRA and its implementing regulations related to the generation, treatment and storage of hazardous waste. A copy of the inspection report is enclosed for your reference.

Based on information provided by the Tribune, EPA's review of records pertaining to the Tribune, and the inspector's observations, EPA has determined that the Tribune has unlawfully stored hazardous waste without a permit or interim status as a result of the Tribune's failure to comply with certain conditions for a permit exemption under III. Admin. Code tit. 35 § 722.134(a)-(c) [40 C.F.R. § 262.34(a)-(c)]. EPA has identified the permit exemption conditions with which the Tribune was out of compliance at the time of the inspection in paragraphs 1-2, below.

At the time of the inspection, the Tribune was out of compliance with the following large quantity generator permit exemption condition:

#### STORAGE OF HAZARDOUS WASTE WITHOUT A PERMIT OR INTERIM STATUS

1. Date When Each Period of Accumulation Begins

Under III. Admin. Code tit. 35 § 722.134(a)(2) [40 C.F.R. § 262.34(a)(2)], a large quantity generator must clearly mark each container holding hazardous waste with the date upon which each period of accumulation begins.

At the time of the inspection, the Tribune was accumulating one container of hazardous waste without the accumulation start date.

Many of the conditions for a RCRA permit exemption are also independent requirements that apply to permitted and interim status hazardous waste management facilities that treat, store, or dispose of hazardous waste (TSD requirements). When a hazardous waste generator loses its permit exemption due to a failure to comply with an exemption condition incorporated from Ill. Admin. Code tit. 35 Part 725, the generator: (a) becomes an operator of a hazardous waste storage facility; and (b) simultaneously violates the corresponding TSD requirement. The exemption condition identified in paragraph 1 is also an independent TSD requirement incorporated from Ill. Admin. Code tit. 35 Part 725. Accordingly, each failure of the Tribune to comply with this condition is also a violation of the corresponding requirement in Ill. Admin. Code tit. 35 Part 725 [40 C.F.R. Part 265].

# STORAGE OF HAZARDOUS WASTE WITHOUT A PERMIT OR INTERIM STATUS AND VIOLATIONS OF TSD REQUIREMENTS

#### 2. Personnel Training

A large quantity generator of hazardous waste must have a program of classroom instruction or on-the-job training that teaches facility personnel to perform their duties in a way that ensures the facility's compliance with requirements of RCRA. This program must be directed by a person trained in hazardous waste management procedures, and must include instruction that teaches facility personnel hazardous waste management procedures (including contingency plan implementation) relevant to the positions in which they are employed. *See* Ill. Admin. Code tit. 35 §§ 722.134(a)(4) and 725.116(a) [40 C.F.R. §§ 262.34(a)(4) and 265.16(a)]. Facility personnel must successfully complete this training program within six months after the date of their employment or assignment to a facility or to a new position at a facility, and must take part in an annual review of this initial training thereafter. *See* Ill. Admin. Code tit. 35 §§ 722.134(a)(4) and 725.116(b) and (c) [40 C.F.R. §§ 262.34(a)(4) and 265.16(b) and (c)]. A large quantity generator of hazardous waste must document that the training or job experience described above has been given to and completed by facility personnel. *See* Ill. Admin. Code tit. 35 §§ 722.134(a)(4) and 725.116(d) [40 C.F.R. §§ 262.34(a)(4) and 265.16(d)].

•					
				-	-
		•			
		•			
		•			
	•	•			
				~	
	4		•		
				·	
	•				

At the time of the inspection, the Tribune did not have records of hazardous waste training given to the following facility personnel: two facility personnel during calendar year 2013; three facility personnel during calendar year 2012; and one facility personnel during calendar year 2011.

By failing to comply with the conditions for a permit exemption, above, the Tribune became an operator of a hazardous waste storage facility, and was required to obtain an Illinois hazardous waste storage permit. The Tribune failed to apply for such a permit. The Tribune's failure to apply for and obtain a hazardous waste storage permit violated the requirements of Ill. Admin. Code tit. 35 §§ 703.121(a) and (b); 703.180(c); and 705.121(a) [40 C.F.R. §§ 270.1(c), and 270.10(a) and (d)]. Any failure to comply with a permit exemption condition incorporated from Ill. Admin. Code tit. 35 Part 725 [40 C.F.R. Part 265] is also an independent violation of the corresponding TSD requirement.

At this time, EPA is not requiring the Tribune to apply for an Illinois hazardous waste storage permit so long as it immediately establishes compliance with the conditions for a permit exemption outlined in paragraphs 1-2, above.

#### **GENERATOR VIOLATIONS**

At the time of the inspection, the Tribune violated the following generator requirements:

#### 3. Recordkeeping

Under Ill. Admin. Code tit. 35 § 722.140(a) [40 C.F.R. § 262.40(a)], a generator must keep a copy of each manifest with the signature from the owner or operator of the designated facility as a record for at least three years from the date the waste was accepted by the initial transporter.

At the time of the inspection, the Tribune did not have records of signed copies from the owner or operator of the designated facility for three hazardous waste manifests.

During the inspection, as observed by EPA, and after the inspection, as documented in your July 17, 2014, July 18, 2014, July 29, 2014, August 5, 2014 and August 18, 2014 emails to EPA, you took certain actions to establish compliance with the permit exemption conditions in paragraphs 1-2, and the generator requirements in paragraph 3, above. Based on the information received from the Tribune on July 17, 2014, July 18, 2014, July 29, 2014, August 5, 2014 and August 18, 2014, EPA is not planning additional enforcement actions based on this inspection at this time. This letter does not limit the applicability of the requirements evaluated, or of other federal or state statutes or regulations. EPA appreciates the Tribune's cooperation.

•		•		•		
						·
				·		
•						
				•		
		•				
		•				
						•
		·			•	
			-			
·						
	•					

If you have any questions regarding this letter, please contact Ms. Graciela Scambiatterra, of my staff, at 312-353-5103 or at <a href="mailto:scambiatterra.graciela@epa.gov">scambiatterra.graciela@epa.gov</a>.

Sincerely,

Gary J. Victorine, Chief

RCRA Branch

Enclosure

cc: Todd Marvel, Illinois Environmental Protection Agency (todd.marvel@illinois.gov)

•		·	
	,		
			•
			•
	•		
		•	
			·

### UNITED STATES ENVIRONMENTAL PROTECTION AGENCY **REGION 5** LAND AND CHEMICALS DIVISION, RCRA BRANCH 77 W. JACKSON BOULEVARD CHICAGO, IL 60604

#### COMPLIANCE EVALUATION INSPECTION REPORT

INSTALLATION NAME: Chicago Tribune - Freedom Center

EPA ID No.:

ILD 045 304 367

**LOCATION ADDRESS:** 

77 West Chicago Avenue

Chicago, Illinois 60610

NAICS CODE(s):

51111 [Newspaper Publishers]

**DATE OF INSPECTION:** July 16, 2014

U.S. EPA INSPECTOR(s): Graciela Scambiatterra

PREPARED BY:

Graciela Scambiatterra

7/8/2015

Environmental/Scientist

APPROVED BY:

Michael Cunningham, Chief

Compliance Section 1

RCRA Branch

Land and Chemicals Division

•		•			-			
			•					
						-		
•								
						•		
					•			
	•							·
•								
•								
						•		
			•					
						. *		
		;						
								,
	**			*			·	
		·						
* *								
	•			•				
								•
								•

#### **RCRA Compliance Evaluation Inspection**

#### Introduction

I, Graciela Scambiatterra, Environmental Scientist, from the United States Environmental Protection Agency (EPA) conducted a hazardous waste compliance evaluation inspection (CEI) at Chicago Tribune (Tribune), located at 77 West Chicago Avenue, Chicago, Illinois. The Purpose of the CEI was to evaluate Tribune's compliance with certain provisions of the Resource Conservation and Recovery Act (RCRA), specifically, those regulations related to the management and disposal of hazardous waste.

Photographs taken during the inspection are attached (*see* Attachment 1). Documents obtained during the inspection are annotated in Attachment 3.

#### History and Interview

I arrived at Tribune on July 16, 2014 at approximately 9:15 a.m., and approached the visitor's entrance/guard station. I informed the guard on duty my purpose for being at the facility and asked to speak to the environmental coordinator, or anyone on staff that deals with the environmental duties at the Tribune. After several attempts, Lynne Allen and Henry Pulkowski met me at the visitor area. She escorted me to a conference room where I held an opening conference. Several other Tribune employees joined us in the conference area. The following individuals were present during the CEI:

NAME	TITLE	EMPLOYER
Gracie Scambiatterra	Environmental Scientist	U.S. EPA
Lynne Allen	Director of Facilities & Engineering	Chicago Tribune
Henry Pulkowski	Chief Engineer, H & A/C	Jones Lang LaSalle
<sup>1</sup> Tonya Powell	Safety Team Leader	Chicago Tribune
Terry Ford	Press Support Supervisor	Chicago Tribune
Marlon R. Medious	Unknown	Chicago Tribune

I provided Tonya Powell with the Small Business Resources Guide. During the opening conference, I explained to the Tribune representatives my purpose for being at the facility and what specific records I would need to review. I informed all of them that they should notify me immediately if any information and/or documents they were providing me were of Confidential Business Information (CBI). I explained to them that any CBI would be handled in accordance with EPA policy. At approximately 10:10 a.m., we moved into Ms. Powell's office and only Ms. Powell and Mr. Ford remained present for the remainder of the CEI. Ms. Powell informed me that she was new to her current position and was still getting up to speed on her new duties. She began her position as Safety Leader for the Tribune in April 2014.

<sup>&</sup>lt;sup>1</sup> Ms. Powell asked for the CEI report and correspondence related to this visit to be sent to her attention.

•		•	·	
				e .
		· ·		•
		•		
	•			
	•	•		
	·			
			•	
	•			
			•	
		·		
		•		
		•		
	•			
			·	-
		·		
		·		•
	·			

Mr. Ford briefly explained the type of hazardous wastes that Tribune generates. Tribune generates a flammable blanket wash waste/waste print ink related material (D001). Blanket wash chemical (flammable) is mixed with water and used to clean the ink buildup from the press blankets. When the hazardous blanket wash waste becomes unusable, it's accumulated onsite and then sent offsite for disposal to Petro-Chem Processing Group in Detroit, Michigan. Petro-Chem Processing Group is a permitted Treatment, Storage and Disposal Facility (TSDF). Tribune also generate a non-hazardous waste ink from their printing process.

The Tribune purchased the facility on or about 1981. The Tribune originally notified EPA of its hazardous waste activities as a large quantity generator (LQG) on or about 1980 and has an NAICS code of 51111 [Newspaper Publishers]. The Tribune employs approximately 700 employees at this location and operates three shifts, 24/7.

The Tribune is has been operating as an LQG, however, they informed me that they have been aggressively working to minimize their waste.

After our opening discussion, approximately 10:40 a.m., I began the records review.

#### **Records Review**

#### Annual Reports

Haza	rdous Waste Annu	al Report	
Calendar Year:	2013	Date Signed:	2/13/14
Certified Mail Receipt: Unknown		*	•
V	Vaste Streams Rep	orted	
D001 (3,320 gal)			
Transporters, and Treatme	ent, Storage, and D	isposal Fac	ilities Used:
Transporter			ILR000130062
Transporter			IND984868406
Transporter			ALD067138891
TSDF			MID980615298

Haz	ardous Waste Annual	Report		
Calendar Year:	2012	Date Signed:	2/18/13	
Certified Mail Receipt: Unknown				
	Waste Streams Repo	rted		
D001 (3,190 gal)				
Transporters, and Treatr	nent, Storage, and Dis	sposal Facilit	ties Used:	
Transporter			ILR000130062	
Transporter		IND984868406	] .	
Transporter			ALD067138891	

•		•		·	
			•		
					,
				•	•
					. *
				•	
	·				
	. *				
		•			
				•	
•					
	•				

Transporter		NJD986607380
TSDF	· .	MID980615298

Haz	zardous Waste Annua	l Report		
Calendar Year:	2011	Date Signed:	Unknown	
Certified Mail Receipt: Unknown	1			
	Waste Streams Repo	rted		
D001 (2,420 gal)				
Transporters, and Treat	ment, Storage, and Dis	sposal Facili	ties Used:	
Transporter			ILR000130062	
Transporter				
TSDF			MID980615298	

#### Manifests/LDRs

I reviewed the manifests and land disposal restriction (LDR) forms for years 2011 until the present time. I noted discrepancies for the following three hazardous waste manifests:

Hazardous Waste Manifests						
Manifest Number	Waste Code(s)	Quantity	Date	TSDF Signature		
002288900GBF	D001	2 drums	12/4/2013	NO		
002275786GBF	D001	3 drums	10/9/2013	NO		
002271951GBF	D001	1 drum	9/24/2013	NO		

In 2013, 2012 and 2011, all hazardous waste generated at the facility and manifested for offsite shipment was sent to MID980615298, Petro-Chem Processing Group in Detroit, Michigan.

During my review of the hazardous waste manifests, I also took note of the Tribune employees signing the manifests for offsite shipments each calendar year:

#### 2014:

- 1. David Cates
- 2. Terry Ford
- 3. Tonya Powell (I was informed Ms. Powell began her position in April)
- 4. Harry Jones

#### 2013:

- 1. Cathy Jackson
- 2. Taheisha Coleman
- 3. Terry Ford
- 4. James Smith
- 5. Gregory Cyphers
- 6. Harry Jones

·	•		•		
•					
•					
		•			
	·				
		•			
•					
	•				
	8			·	
			:		
					•
<u>.</u>					
•					
			•		
				*	

Chicago Tribune. RCRA CEI July 16, 2014

EPA ID Number: ILD 045 304 367

#### 2012:

1. Harry Jones

- 2. Robert Richards
- 3. Terry Ford
- 4. John Cousins
- 5. Linda Williams

#### <u>Training</u>

I asked Ms. Powell and Mr. Ford for the all the training records for employees undergoing hazardous waste management training (RCRA) in 2013, 2012 and 2011. I was provided with the following:

2013: training provided by Terry Ford

- 1. Harry Jones on 11/10/13.
- 2. James Smith on 11/10/13.
- 3. Greg Cyphers on 11/10/13.

2012: training provided by Terry Ford

1. Linda Williams on 3/1/2012.

2011: training provided by Terry Ford

- 1. John Cousins on 3/26/11.
- 2. Jon Healy on 4/21/11.
- 3. Joseph Weichinger on 3/26/11.
- 4. Lametra Elder on 3/31/11.
- 5. Terofilo Yu on 4/21/11.
- 6. Jesus Rodriguez on 4/21/11.
- 7. Esperanza Hernandez on 5/6/11.

I informed Ms. Powell and Mr. Ford that I had not been given training records to review for some Tribune employees that were directly involved in hazardous waste duties, specifically, signing hazardous waste manifests.

#### Contingency Plan

Ms. Powell provided the Contingency Plan for my review. The plan was originally prepared by Tribune staff and dated October 2010. The plan states that October 2010 is the most recent update. Ms. Powell and Mr. Ford informed me that the update had to do with general updates (contractor and operational changes, updated contact information, etc) and not because the Tribune had to implement the plan and it failed.

The plan I reviewed listed Frank Rocco as the Primary Emergency Coordinator, and Tom Bielke as the Secondary Emergency Coordinator.

		•		·	
			•		
			*		
	· ·				
	·				
•					
÷					
•					
	•				
		•			
		•			

An evacuation plan and map with routes, and an emergency response procedure for spills were included in the plan.

Additionally, the plan contained arrangements made with the Chicago police, fire, local hospital and emergency response contractor, as well as emergency response equipment and their location.

#### Universal Waste

I ask to review the waste documents for the facility's universal waste for the last three years. Ms. Powell and Mr. Ford informed me that they would need to provide them at a later date because they didn't know where they were being stored.

#### Hazardous Waste Determinations

I asked Ms. Powell and Mr. Ford for the hazardous waste determinations for the following waste streams:

- 1. Blanket Wash
- 2. Waste Ink

They could not locate them during the inspection. Ms. Powell informed me she would look for them and provide them to me at a later date.

#### **Inspection Reports**

I asked Mr. Ford for the last three years of inspection records for the less than 90-day accumulation area. I took note that the following individuals conducted the weekly inspections:

- 1. Terry Ford
- 2. Greg Cyphers

The checklist I reviewed included checking for: drum labeling, container leaks, closed containers, aisle space, eye wash station, and damaged containers.

I concluded the records review at 1:15 p.m. and prepared for the site inspection portion of the CEI.

#### **Site Inspection**

The Tribune site inspection began at 1:20 p.m. in the Floor Machine Shop on the 2<sup>nd</sup> floor. This area is where printing equipment is fixed and repaired. A parts washer machine is used in this area to clean the various printing equipment parts. A solvent from Crystal Clean is used in the parts washer and has a flashpoint over 140°F. The solvent waste from this machine is a non-hazardous waste.

The next area we inspected was the Press Room. Mr. Ford informed me that the Tribune had ten presses, of which eight were exactly the same. The two different presses were used to create the Wall Street Journal and the New York Times newspapers due to the color capacity needed for those two publications.

The ink used on the press machines is soy-based. We walked over to one of the blanket wash areas next to a press. Blanket wash solution is used to clean the ink buildup on the press blankets and other parts of the press equipment. Blanket wash rinses are placed in buckets and then used around a press area. Several buckets are used throughout the ten presses in the facility. When the bucket full of blanket wash solution becomes unusable, or too dirty with print ink, the blanket wash waste (also referred to as "waste print ink related material" is accumulated in 55-gallon drums in the less than 90-day hazardous waste storage area. Each unit also has a drip pad to capture the excess ink. The ink waste by itself is a non-hazardous waste.

Within the Press Room are five Quiet/Control Rooms (one for every two presses). We walked in the room between press numbers seven and eight. Mr. Ford explained that quality control occurs in these rooms (i.e. color and printing adjustments, etc). I observed two Tribune employees in this area looking over the quality of the product currently being produced from press number seven.

The next area we inspected was the Ink Cleanup Room. Here, the flammable blanket wash chemical gets mixed with water for each press area. Blanket wash chemical arrives at the Tribune in 330-gallon totes and is stored in this area until needed. When the blanket wash chemical gets mixed, it's placed in hand-held containers to be used in the press area (see photo 1). Buckets are used to capture the rinses and they are re-used several times on the press machines until the blanket wash rinses become a hazardous waste. Once this determination is made, the buckets of hazardous waste are taken to the less than 90-day storage area and placed in 55-gallon containers. The less than 90-day storage area was also located in this area. We walked over to the storage area and I observed three 55-gallon containers in the area (see photo 2). The container on the left was the only one containing hazardous blanket wash waste and was labeled with the words "waste print ink related material." I took a closer look at the Hazardous Waste label and noted that it did not have the accumulation start date written anywhere on the label. I checked the rest of the container and did not see the accumulation start date anywhere else on the container. I pointed this out to Mr. Ford and Ms. Powell.

We then walked through the Ink/Oil Storage area where most of the material that is needed for the press machines is stored. I did not observe any waste in this area.

The final area we inspected was the Ryco Room. Used oil, generated from the maintenance of the press machines, is brought to this area and stored in 330-gallon totes (see photo 3). At the time of the CEI, the Used Oil tote was approximately half full.

Chicago Tribune.-RCRA CEI July 16, 2014

EPA ID Number: ILD 045 304 367

The Tribune site inspection ended at approximately 2:15 p.m., at which time we returned to the office area to conclude the CEI and hold a brief closing conference.

#### **Closing Conference**

I held a closing conference with Ms. Powell and Mr. Ford in attendance. The following topics were discussed:

- 1. Training: we discussed the missing training records for Cathy Jackson and Taheisha Coleman during calendar year 2013; Harry Jones, Robert Richards, and John Cousins during calendar year 2012; and Terry Ford's training in 2011 or 2010 for being the Tribune's RCRA trainer in 2011, 2012 and 2013.
- 2. Waste determinations: we discussed the missing waste determinations for the blanket wash waste and the waste ink waste.
- 3. Universal Waste documents: we discussed the missing universal waste documents for the Tribune's offsite universal waste shipments between 2011 through 2013.
- 4. Hazardous Waste: we discussed the missing accumulation start date on the 55-gallon container of hazardous blanket wash waste/waste print ink related material.
- 5. Hazardous waste manifests: we discussed the three hazardous waste manifested shipments that were missing the copy of the final signature from the TSDF that the waste had been accepted for treatment and/or disposal.

Ms. Powell and Mr. Ford informed me that they would provide me a written update as soon as possible (via email or fax) concerning all the five topics discussed above.

I completed the CEI and departed the facility at approximately 3:15 p.m.

#### ATTACHMENTS: (3)

Attachment 1 Photograph taken during the inspection

Attachment 2 Inspection checklist

Attachment 3 List of documents obtained during the CEI

\$					•	
		*				
					·	
						•
				•		
			*	•		
						·
			•			
		•				
			. •			
				•		
	•					
		•	•			

#### Attachment 1 Chicago Tribune- Freedom Center RCRA ID: ILD 045 304 367 July 16, 2014



Photo 1. Photographer: G. Scambiatterra. Time: 1:51 p.m. Description: Blanket wash mix to be used to clean the press blankets full of ink.

•	·		·	
		•		
~				
	•			
				•
		•		
			•	
			,	
			•	
	•			
+				
		•		
•				
			•	
	,			
•				
•				
			,	
		•		

### Attachment 1

Chicago Tribune- Freedom Center RCRA ID: ILD 045 304 367



Photo 2. Photographer: G. Scambiatterra. Time: 1:53 p.m.

Description: Blanket wash waste/waste print ink related material (left container).

Container did not have an accumulation start date. Right containers are non-hazardous waste.

		•			
			,		
·				•	
		•			·
·			e <sup>ne</sup>		
	•				
				4	
-					
		*			
•					

Attachment 1
Chicago Tribune- Freedom Center
RCRA ID: ILD 045 304 367
July 16, 2014

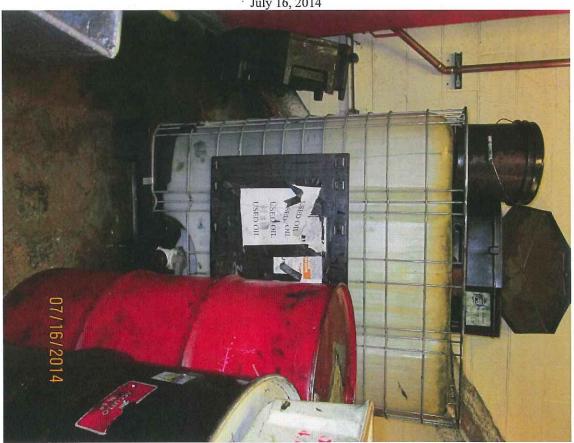


Photo 3. Photographer: G. Scambiatterra. Time: 2:00 p.m. Description: Used oil tote – half full.

Installation Name: Chicago Tribune-Freedom Center Date of Inspection:

Date of Inspection: July 16, 2014 Location Address: 77 West Chicago Avenue U.S. EPA Inspector: Graciela Scambiatterra **EPA ID Number:** ILD 045 304 367

## **Attachment 2**

Regulation	RCRA GENERATOR INSPECTION CHECKLIST (PART 722)	Violation
Regulation	PART 722: STANDARDS APPLICABLE TO GENERATORS OF HAZARDOUS WASTE (>1000 KG/MO.)	
	SUBPART A: GENERAL	
22.111	Section 722.111 Hazardous Waste Determination  Has the generator correctly determined if the solid waste(s) it generates is a hazardous waste?	
	Have hazardous wastes been identified for purposes of compliance with Part 728?  Yes No N/A N/A N/A	722.111
08.121(a)	Has the generator correctly determined if the solid waste(s) it generates is a special waste?  Yes No N/A	·
22.112(a)	Section 722.112 USEPA Identification Numbers Has the generator obtained a USEPA identification number?  Yes No N/A	808.121(a)
		722.112(a)
22.112(c)	Has the generator offered its hazardous waste only to transporters or to treatment, storage or disposal facilities that have a USEPA identification number?	
	Yes No N/A	722.112(c)
	SUBPART B: THE MANIFEST	
22.120(a)	Section 722.120 General Requirements Does the facility manifest its waste off-site?  Yes  No  N/A	
22.120(b)	Does the manifest designate a facility permitted to handle the waste?  Yes No N/A	722.120(a)
22.120(d)	Has the generator shipped any waste that could not be delivered to the designated facility?  YesNoN/A	722.120(b).
	Section 722.121 Acquisition of Manifests Has the generator used:	722.120(d)
722.121(a)	- an Illinois manifest for wastes designated to a facility within Illinois?  Yes	722.121(a)
22.121(b)	- a manifest from the State to which the manifest is designated?  Yes No N/A	
	- an Illinois manifest if the State to which the wasto is designated has no manifest of its own?  Yes No N/A	722.121(b)
	Section 722.122 Number of Copies	
722.122	Does the manifest consist of at least 6 copies?  Yes No N/A	722.122
22.123(a)	Section 722.123 Use of the Manifest For each manifest reviewed, has the generator: - signed the certificate by hand?	
	Yes No N/A  - obtained the handwritten signature and the date of acceptance by the initial transporter?  Yes No N/A	722.123(a)
	- retained one copy as required by Section 722.140(a)?  Yes No N/A	
	- apparently sent a copy (part 5 for the Illinois manifest) to the Agency within 2 working days?  Yes No N/A	
722.123(b)	- has the generator apparently given the remaining/copies to the transporter?	722.123(b)

 Installation Name: Chicago Tribune-Freedom Center

Date of Inspection: July 16, 2014 Location Address: 77 West Chicago Avenue U.S. EPA Inspector: Graciela Scambiatterra **EPA ID Number:** ILD 045 304 367

### Attachment 2

Regulation	RCRA GENERATOR INSPECTION CHECKLIST (PART 722)	Violation				
722.123(c)	- has the generator followed the procedures prescribed in Section 722.123 for manifesting bulk shipments of hazardous waste by rail or water?  Yes No N/A					
		722.123(c)				
	SUBPART C: PRE-TRANSPORT REQUIREMENTS					
722 120	Is there any hazardous waste ready for transport off-site?  Yes					
722.130	If so, is the generator complying with the pre-transport requirements in Subpart C?  Yes No N/A	722.130				
(722.134(a))	Section 722.134 Accumulation Time  Has the generator complied with the following requirements:  Yes					
(722.134(a)(1))	A) For waste in containers, has the generator complied with the requirements of Part 725, Subpart I, AA, BB, and CC?					
	Yes No N/A					
	B) For waste in tanks, has the generator complied with the requirements of Part 725, Subpart J, AA, BB, and CC (except Sections 725 297(c) and 725 300)?					
	Yes No N/A					
	C) For waste on drip pads, has the generator complied with the requirements of Part 725, Subpart W and					
	and/or D) For waste in containment buildings, has the generator complied with Part 725, Subpart DD and maintained the required records identified in this subsection?					
	Yes No N/A					
(722.134(a)(2))	For waste in containers, has the generator marked and made visible for inspection on each container, the date upon which accumulation began?  Yes No N/A					
(722.134(a)(3))	For waste in containers and tanks, has the generator marked or labeled each with the words "Hazardous					
(	Waste"?  Yes No N/A					
(722.134(a)(4))	Has the generator complied with the requirements of Part 725, Subparts C and D, and Sections 725.116 and 728.107(a)(4)?					
	Yes No N/A					
	Specifically, the requirements of items 1 and/or 4 above (listed by regulation) which need to be complied with are as follows:					
	Does the facility accumulate hazardous waste in containers?  Yes No N/A					
	If "No", go to Subpart J.					
	SUBPART I: USE AND MANAGEMENT OF CONTAINERS					
(725.211)	Has the generator closed an accumulation area?  Yes  No  N/A	725.211				
(725.211)	If "Yes", was the accumulation area closed in accordance with Sections 725.211 and 725.214?  Yes No N/A	725.214				

		•	•
•		•	
-			
			•
			•
	•		
•			

Installation Name: Chicago Tribune-Freedom Center Date of Inspection:

July 16, 2014

Location Address: 77 West Chicago Avenue U.S. EPA Inspector: Graciela Scambiatterra **EPA ID Number:** ILD 045 304 367

### Attachment 2

Regulation	RCRA GENERATOR INSPECTION CHECKLIST (PART 722)	Violation
(725.271)	If the containers have leaked or are in poor condition, has the owner/operator transferred the hazardous waste to a suitable container?  YesNoN/A	
(725.272)	Is the waste compatible with the container and/or liner?  Yes No N/A	
(725.273(a))	Are containers of hazardous waste always closed except to remove or add waste during accumulation?  YesNoN/A	
(725.273(b))	Are containers of hazardous waste being opened, handled, or stored in a manner which will prevent the rupture of the container or prevent it from leaking?  Yes	
(725.274)	Is the owner/operator inspecting the accumulation area(s) at least weekly, looking for leaks or deterioration?  Yes	
(725.276)	Are containers holding ignitable or reactive wastes located at least 15 meters (50 feet) from the facility's property line?  Yes No No N/A  Note: See Section 725.117(a) for additional requirements for ignitable, reactive or incompatible wastes.	
(725.277)	Is the owner/operator complying with the requirements concerning incompatible wastes?  YesNoN/A  COMMENTS:	
(725.278)	Section 725.278 Air Emission Standards  Is the owner or operator managing all hazardous waste placed in containers in accordance with Subparts AA, BB and CC of Part 725?  Yes No N/A  Comments:  Does the generator accumulate and/or treat hazardous waste in tanks?  Yes No N/A  Yes No N/A	
(725.211) (725.214)	SUBPART J: TANK SYSTEMS  Has the generator closed an accumulation area?  Yes No N/A  If "Yes", was the accumulation area closed in accordance with Sections 725.211 and 725.214?  Yes No N/A	725.211 725.214

,	·		•	,			
							•
					•		,
					7		
•							
							·
•							
		·					
						·	
						,	
	•			•			

Installation Name:

Chicago Tribune-Freedom Center Date of Inspection: July 16, 2014

Location Address: 77 West Chicago Avenue U.S. EPA Inspector: Graciela Scambiatterra

EPA ID Number: ILD 045 304 367

	RCRA GENERATOR INSPECTION CHECKLIST (PART 722)				
Regulation					
(725.290)	Does the facility accumulate or treat hazardous waste in tanks?  Yes				
	Note: A generator may treat hazardous waste in a tank for less than 90 days without a RCRA permit.				
	If "No", skip Subpart J.				
·	<ul> <li>a) Tank systems that are used to accumulate or treat hazardous waste which contains no free liquids (using the Paint Filter Liquids Test) and that are situated inside a building with an impermeable floor are exempted from the requirements in Section 725.293.</li> <li>b) Tank systems, including sumps, that serve as part of a secondary containment system to collect or contain releases of hazardous wastes are exempted from the requirements in Section 725.293(a).</li> <li>c) Tanks, sumps and other collection devices used in conjunction with drip pads (as defined in Section 720.110) and regulated under Subpart W, must meet the requirements of this Subpart.</li> </ul>	·			
(725.291(a))	For tanks <b>existing</b> prior to July 14, 1986 (see definition of tank system under 720.110) and not protected by a secondary containment system, has a written assessment been reviewed and certified by an IRPE(*) in accordance with Section 702.126(d) by January 12, 1988 [except as provided in Section 725.291(c)]?  Yes No N/A				
(725.291(b))	Does this assessment consider at least the following:  1) design standards for the tank and ancillary equipment?  Yes				
	*IRPE = Independent Registered Professional Engineer				
(725.291(c))	Has a tank system assessment been performed within 12 months after the materials in the tank become a hazardous waste?  YesNoN/A				
	Note: If an assessment indicates a tank system is leaking or unfit for use, the owner/operator must comply with the requirements of Section 725.291(b)(5).				

	•				•	
			•			
		•				
					·	
	,	)				•
			•			
•	•					
		·				
		·				
	•					
				•		
						:

Location Address: 77 West Chicago Avenue U.S. EPA Inspector: Graciela Scambiatterra EPA ID Number: ILD 045 304 367

Regulation	RCRA GENERATOR INSPECTION CHECKLIST (PART 722)	Violation			
725.292(a))	For <b>new</b> tanks (see definition of new tanks under Section 720.110) whose installation commenced after 07/14/86, has a written assessment been reviewed and certified by an IRPE in accordance with Section 702.126(d) prior to operation of the tank system?				
	Yes No N/A				
	Does the assessment include, at a minimum, the following:  1) design standards for tanks and ancillary equipment?				
	YesNoN/A				
	2) hazardous characteristics of the waste(s) to be handled?  Yes No N/A				
	3) evaluation of potential for corrosion and corrosion protection measures for tank systems with metal components in contact with soil or water?				
	Yes No N/A				
	4) design or operational measures that will protect underground tank systems from potential damage resulting from vehicular traffic?				
	Yes No N/A				
	5) designs to ensure adequate foundations, anchoring to prevent flotation or dislodgment and the ability to withstand the effects of frost heave?				
	Yes No N/A				
(725.293(a))	Yes No N/A  Is secondary containment provided for any new tank system before being put into service?				
(725.293(a))	Yes No N/A				
	Does an existing tank, used to accumulate F020, F021, F022, F023, F026 or F027 waste(s), have secondary containment by 1/12/89?				
	Yes No N/A  For an existing tank of documentable age, is secondary containment provided by 1/12/89 or when the tank is 15 years old, whichever is later?				
	Yes No N/A				
	For an existing tank of undocumentable age, has secondary containment been provided by 1/12/95?  Yes  No  N/A				
	or if the facility is older than 7 years, by the time the facility reaches 15 years of age or 1/12/89, whichever is later?				
	Yes No N/A  For tanks that accumulate wastes that become hazardous after 1/12/87, has secondary containment been provided within the time intervals required in Subsections (a)(1) through (a)(4) substituting the date that a material becomes a hazardous waste for 1/12/87?				
	Yes No N/A				
725.293(b))	Is the secondary containment system designed, installed and operated to prevent migration of wastes of accumulated liquid out of the system at any time?				
	Yes No N/A				
	Is the secondary containment system capable of detecting and collecting releases and accumulated liquids until				
	the collected material is removed?  Yes No N/A				

		•			
					4
•					
					•
		·			
	•				
•					
				•	
				•	
	•				
•					
					•
			•		
				•	
		•			
				•	,

Location Address: 77 West Chicago Avenue U.S. EPA Inspector: Graciela Scambiatterra **EPA ID Number:** ILD 045 304 367

Regulation	RCRA GENERATOR INSPECTION CHECKLIST (PART 722)	Violation
(725.293(c))	To meet the requirements of Subsection (b), is the secondary containment system:  1) compatible with the waste(s) in the tank and of sufficient strength and thickness to prevent failure?	
	Yes No N/A  2) placed on a foundation or base capable of providing support, providing resistance to pressure gradients and preventing failure due to settlement, compression of uplift?  Yes No N/A	
	Yes No N/A	
	4) sloped or otherwise designed or operated to drain and remove liquids resulting from leaks, spills or precipitation?  Yes No N/A	
	and is spilled or leaked waste and accumulated precipitation removed from the secondary contamment within 24 hours?  Yes No N/A	
	Note: A RCRA permit may allow for removal of liquids less frequently than 24 hours after accumulation.	
(725.293(d))	Does the secondary containment for tanks have one or more of the following:  1) a liner (external to the tank); or 2) a vault; or 3) a double-walled tank; or 4) an equivalent device (approved by the Board)?  Yes	
(725.293(e))	Does the external liner system(s), vault system(s) and/or double-walled tank(s) meet the additional requirements identified in Section 725.293(e)?  Yes No N/A	
(725.293(f))	Is ancillary equipment protected by secondary containment that meets the requirement of Subsection (h) and (c)?  Yes No N/A	
	If "No":  1) Is aboveground piping (exclusive of flanges, joints, valves and connections) inspected daily?  Yes No N/A  2) Are welded flanges, joints and connections inspected daily?  Yes No N/A  3) Are sealless or magnetic coupling pumps and sealless valves inspected daily?  Yes No N/A  4) Are pressurized aboveground piping systems with automatic shut-off devices inspected daily?  Yes No N/A	
(725.293(i))	Until such time as secondary containment is provided, are the following requirements being met for all tank systems:  1) For non-enterable underground tanks, has an annual leak test that meets the requirements of 725.291(b)(5) been conducted?  Yes No N/A	
	Note: If a tank system is found to be leaking or unfit for use as a result of a leak test or assessment, the owner/operator must comply with Section 725.296.	

		•	•			
					÷	
		*	-			
			-			
		,	•			
			÷		•	
	e.					
•						
				•		
		·				
			•	•		
	,					
		•				
•						

Installation Name: Chicago Tribune-Freedom Center

Date of Inspection: July 16, 2014

**Location Address:** 77 West Chicago Avenue U.S. EPA Inspector: Graciela Scambiatterra

EPA ID Number: ILD 045 304 367

Regulation	RCRA GENERATOR INSPECTION CHECKLIST (PART 722)	Violation
725.294(a))	Has the owner/operator placed hazardous wastes or treatment reagents in the tank system that could cause the	
, (_,,)	system to rupture, leak, corrode or otherwise fail?	
	YesNoN/A	
(725.294(b))	Do tanks and secondary containment have appropriate controls and practices to prevent spills and overflows including:	
	1) spill prevention controls?  YesNoN/A  2) overfill prevention controls?	
	2) overfill prevention controls?  YesNoN/A	
	3) sufficient freehoard in uncovered tanks?	
	Yes No N/A	
725.294(c))	Note: If a leak or spill has occurred in the tank system, the owner/operator shall comply with the requirements of Section 725.296.	
(725.295(a))	Does the owner/operator inspect, if present, at least each operating day, the following:  1) overfill/spill control equipment?	
	Yes No N/A 2) the aboveground portion of the tank system for corrosion or releases?	
	Yes No N/A  2) the aboveground portion of the tank system for corrosion or releases?  Yes No N/A  Yes No N/A	
	3) data from monitoring equipment?	
	YesNoN/A	
	4) the construction materials and the area immediately surrounding the external portion of the system?  Yes	
<u> </u>		
(725.295(b))	If the tank system has cathodic protection, is the owner/operator complying with Section 725.295(b) to ensure that they are functioning properly?	
	Yes No N/A	
(725,295(c))		
(723.293(6))	Does the owner/operator document in the operating record, the results of tank inspections as required in Section 725.295(a) and (b)?	
•	YesNoN/A	1
(725.296)	If the tank system or secondary containment system has a leak or spill or is unfit for use, has the	
	owner/operator:	
	a) immediately ceased using; prevented flow or addition of waste and inspected the system to determine the cause of the release?	
	Yes No N/A	
	b) removed applicable waste from the system within 24 hours of detection?	
	Yes No N/A	
	c) immediately conducted a visual inspection of the release and taken actions to contain visible releases	
	to the environment, prevented further migration to soils or surface water and removed and properly disposed of any contaminated soil or water?	
	Yes No N/A	
(725.206(4))	d) notified the Agency within 24 hours of detection of release?	
(725.296(d))	d) notified the Agency within 24 hours of detection of release?  Yes  No  N/A	
	d)3) within 30 days of detection of release, submitted a report to the Agency that complies with/the	
	requirements of Section 725.296(d)(3)?	
	Yes No N/A V	

		•	
	· ·		,
		•	
		·	•
			•
		•	
•			
•			
			·
			•

July 16, 2014

Location Address: 77 West Chicago Avenue U.S. EPA Inspector: Graciela Scambiatterra **EPA ID Number:** ILD 045 304 367

Regulation	RCRA GENERATOR INSPECTION CHECKLIST (PART 722)	Violation
(725.296(e))	e) repaired the tank system prior to returning the tank system to service in the event that a leak has occurred from the primary tank system into the secondary containment system?  Yes No N/A	
(725.296(f))	f) In the event that an extensive repair has been conducted in accordance with subsection (e), submitted to the Agency within 7 days after returning the tank system to use, a certification by an IRPE stating that the repaired system is capable of handling hazardous wastes without release for the intended life of the system?  YesNoN/A  Note: If the owner/operator does not satisfy the requirements of subsections (e)(2) through (e)(4), the tank system must be closed in accordance with Section 725.297.	
(725.297(a))	At the time of closure of a tank system, has the owner/operator removed or decontaminated all waste residues, contaminated components, contaminated soils and structures and equipment and managed them as hazardous waste [unless Section 721.103(d) applies]?  YesNoN/A	
(725.297(a))	Have the closure plan, closure activities, cost estimates for closure and financial responsibility for tank systems met all requirements specified in Subparts G and H?  YesNoN/A	
(725.297(b))	If the tank system cannot be "clean" closed, has the owner/operator closed the tank system and performed post-closure care in accordance with the closure and post-closure care requirements that apply to landfills (Section 725.410)?  Yes No N/A  Note: Such a tank system is considered a landfill and must meet all of the requirements of landfills specified in Subparts G and H.	
(725.298(a))	Are ignitable or reactive wastes placed in a tank system?  YesNoN/A	
	If "No", skip to Section 725.299.  Is the waste treated, rendered or mixed before or immediately after placement in the tank system so that:  - the resulting waste, mixture or dissolved material is no longer ignitable or reactive?  Yes No N/A	
	or Is the tank used solely for emergencies?  YesNoN/A	

	•					•	
					·		
		,					
			·				
				·			
÷		·					

Location Address: 77 West Chicago Avenue U.S. EPA Inspector: Graciela Scambiatterra **EPA ID Number:** ILD 045 304 367

Regulation	RCRA GENERATOR INSPECTION CHECKLIST (PART 722)	Violation
(725.298(b))	Is the facility complying with the requirements regarding maintenance of protective distances between the waste management area and any public ways, streets, alleys or any adjoining property line?  Yes	
(725.299)	Are incompatible wastes/materials placed in the same tank?  Yes No N/A	
•	If "No", skip to Section 725.300.	
	Is Section 725.117(b) being complied with?  Yes No N/A	
	Yes No N/A  Has the tank system been properly decontaminated if it previously held an incompatible waste/material unless  Section 725.117(b) is complied with?  Yes No N/A	
	COMMENTS:	
(725.302)	Section 725.302 Air Emission Standards Is the owner or operator managing all hazardous waste placed in tanks in accordance with Subparts AA, BB and CC of Part 725?  Yes No N/A	
	Comments:	
(725.131)	SUBPART C: PREPAREDNESS AND PREVENTION  Is the facility being operated and maintained to minimize the possibility of a fire, explosion or any release of hazardous waste or hazardous waste constituents which could threaten human health or the environment?  Yes	
(725.132)	Is the facility equipped with the following, if necessary:  a) an internal communication or alarm system(s)?  Yes No N/A  b) a telephone or other device to summon emergency assistance from local authorities?  Yes No N/A  c) portable fire extinguishers, fire control equipment, spill control equipment and decontamination equipment?  Yes No N/A  d) water at adequate volume and pressure for fire control?  Yes No N/A	
(725.133)	Is the facility testing and maintaining communication/alarm system(s), fire protection equipment, spill control equipment and decontamination equipment?  Yes	
(725.134)	a) Where hazardous waste is being handled, do all employees have immediate access to an internal alarm or other emergency communication device?  Yes No N/A  b) If there is ever just one employee on the premises when the facility is operating, does he/she have immediate access to a device capable of summoning external emergency assistance?	
	Yes No N/A	

•								
				•				
			•					
	,							
					•			
						•		
			,		•			
					·			
							•	
			-			•		
	•							
						•		
					:			
		*						
							,	•
					·			
-								
		•						
						•		

Location Address: 77 West Chicago Avenue U.S. EPA Inspector: Graciela Scambiatterra **EPA ID Number:** ILD 045 304 367

Regulation	RCRA GENERATOR INSPECTION CHECKLIST (PART 722)	Violation			
(725.137)	Has the facility attempted to make the following arrangements, as appropriate, for the type of facility and waste:  - arrangements with local emergency authorities (i.e. police and fire departments, other emergency response agencies) to familiarize them with the layout of the facility, properties of hazardous waste handled, places where facility personnel would be working, entrances to roads inside the facility and evacuation routes?  Yes No N/A  - agreements designating the primary authority where more than one police or fire department might				
	respond?  Yes No N/A  agreements with State emergency response teams, contractors and equipment suppliers?  Yes No N/A  arrangements to familiarize local hospitals with the properties of hazardous waste handled at the facility and the type of injuries or illnesses which could result from fires, explosions or releases at the facility?  Yes No N/A				
	SUBPART D: CONTINGENCY PLAN AND EMERGENCY PROCEDURES				
(725.151(a))	Is the contingency plan available?  Yes No N/A  If "No", skip to Section 725.155.  Is the plan designed to protect human health and the environment from releases to the air, soil and water?  Yes No N/A	3			
(725.151(b))	Has there been a fire, explosion or release of hazardous waste?  Yes No N/A  If "Yes", has the contingency plan been carried out immediately?  Yes No N/A				
(725.152(a))	Does the plan describe the actions required for response to:  - fires? Yes No N/A  - explosions? Yes No N/A  - releases? Yes No N/A				
(725.152(c))	Does the plan describe arrangements with:  - police and fire departments? Yes No N/A - hospitals?Yes No N/A - contractors? Yes No N/A - emergency response teams? Yes No N/A				
(725.152(d)	Does the plan contain the current emergency coordinator's name, phone (office and home) and address?  Yes				
(725.152(e))	Does the plan identify all emergency equipment including:  - description? Yes No N/A  - capability? Yes No N/A  - location? Yes No N/A  Is the list of emergency equipment up-to-date?  Yes No N/A				
(725.152(f))	Does the plan include:  - an evacuation plan? Yes No N/A  - an evacuation signal? Yes No N/A  - alternate evacuation routes? Yes No N/A				

			,			
	•					
					•	
						÷
	•					
		*	•			
	·					
		,				
•						
		*				

Location Address: 77 West Chicago Avenue U.S. EPA Inspector: Graciela Scambiatterra **EPA ID Number:** ILD 045 304 367

	RCRA GENERATOR INSPECTION CHECKLIST (PART 722)					
Regulation						
(725.153)	Has the contingency plan (including all revisions) been:  a) maintained at the facility? Yes No N/A  b) submitted to:					
	- police department? Yes No N/A					
	- hospital? Yes No N/A - emergency response teams? Yes No N/A					
(725.154)	Has the contingency plan been reviewed and revised whenever:					
	a) regulations are revised? Yes No N/A b) the plan fails in an emergency? Yes No N/A					
	c) the facility changes in a way that modifies the emergency response necessary?  Yes No N/A					
	d) information regarding emergency coordinators changes?  Yes No N/A					
	e) information regarding equipment changes?  Yes No N/A					
(725.155)	Is the emergency coordinator on-site or on call at all times?					
	Yes No N/A  Is the emergency coordinator familiar with all facility activities, wastes, records, layout and contingency plan?					
	Yes No N/A  Does the emergency coordinator have the authority to commit the resources needed to carry out the actions specified in the contingency plan?					
	Yes					
(725.156)	If the facility has had a release, fire or explosion, have the procedures of this Section been followed regarding assessment, response and reporting?					
	Yes No N/A					
	Note: If the facility has had a release, explain in detail.					

		•	
	•		
		•	
		•	
			•
. •			
		•	
	•		
		•	
·			

Location Address: 77 West Chicago Avenue U.S. EPA Inspector: Graciela Scambiatterra **EPA ID Number:** ILD 045 304 367

	Violation				
Section 725.116 Personnel Training					
them to perform their duties in a way that ensures the facility's compliance with the requirements of Part 725?					
Yes 4 No N/A					
plan implementation) relevant to the positions in which they are employed?					
- procedures to familiarize facility personnel with emergency procedures, emergency equipment and					
1					
- procedures for using, inspecting, repairing and replacing facility emergency and monitoring					
YesNoN/A					
- communications or alarm systems?					
- response to fire or explosions?					
Yes No N/A	-				
·					
Have new employees completed the program within 6 months of the date of employment or assignment to a					
Y es V No N/A N/A					
Have facility personnel received an annual review of the initial training?					
10 <u>1</u>					
Are the following documents and records being maintained at the facility:					
1) the job title for each position related to hazardous waste management and the name(s) of the					
employee(s) filling each job?					
Yes					
	•				
100 110 11/14					
Is the facility maintaining training records until closure of the facility and those of former employees for at					
least 3 years from the last date of employment?					
Yes No N/A					
	Does the facility have a training program?  Yes No N/A  Have facility personnel successfully completed a program of classroom or on-the-job training that teaches them to perform their duties in a way that ensures the facility's compliance with the requirements of Part 725?  Yes No N/A  Is the program directed by a person trained in hazardous waste management procedures?  Yes No N/A  Does the program teach facility personnel hazardous waste management procedures (including contingency plan implementation) relevant to the positions in which they are employed?  Yes No N/A  Does the program cover, at a minimum:  - procedures to familiarize facility personnel with emergency procedures (including contingency plan implementation) relevant to the positions in which they are employed?  No N/A  Does the program cover, at a minimum:  - procedures for unimiliarize facility personnel with emergency procedures, emergency equipment and emergency systems?  Yes No N/A  - procedures for using, inspecting, repairing and replacing facility emergency and monitoring equipment?  Yes No N/A  - key parameters for automatic waste feed cut-off systems?  Yes No N/A  - response to fire or explosions?  Yes No N/A  - response to fire or explosions?  Yes No N/A  Have new employees completed the program within 6 months of the date of employment or assignment to a position requiring them to manage hazardous waste?  Yes No N/A  Have facility personnel received an annual review of the initial training?  Yes No N/A  Are the following documents and records being maintained at the facility:  1) the job title for each position related to hazardous waste management and the name(s) of the employee(s) filling each job?  Yes No N/A  Are the following documents and records being maintained at the facility:  1) the job title for each position related to hazardous waste management and the name(s) of the employee(s) filling each job?  Yes No N/A  Are the following documents and records being maintained at the facility:  1) the job title for each position rel				

			•	
	•			
		•	•	
			•	
				•
		••		
		•		
			•	
		·		
				•
	•			
			•	
				•
		•		
pri.				
••				
•				
er.	·			
w.	·			
•	·			
-				
-				

Location Address: 77 West Chicago Avenue U.S. EPA Inspector: Graciela Scambiatterra **EPA ID Number:** ILD 045 304 367

Regulation	RCRA GENERATOR INSPECTION	CHECKLIST (	PART 722)	Violation	
728.107(a)(5))	Section 728.107 Waste Analysis and Recordkeeping Has the generator who treats a prohibited waste in tanks or containers in order to meet the treatment standards developed and followed a waste analysis plan?				
	Yes Is the plan on-site?		N/A		
	Yes	No	N/A		
	Yes Has the plan been filed with the Agency at least 30 days prior	No to commencement of	N/A		
•	YesHas the generator submitted the required notification and cert when the waste is shipped off-site?	Noification that the wast	N/Ae meets treatment standards		
		No	N/A		
22.134(c)	Section 722.134 Satellite Accumulation Is the generator who accumulates hazardous waste at or near accumulate and which is under the control of the operator of accumulation to 55 gallons of hazardous waste or 1 quart of a 725.271, 725.272 and 725.273(a), and marking the containers words identifying the contents?  Yes	he process generating cutely hazardous was	the waste, limiting such te, complying with Sections		
	Has the generator who accumulates more than 55 gallons of I waste complied with the requirements of Section 722.134(a)	azardous waste or 1 q	uart of acutely hazardous		
·	Yes	ft of acutely hazardou			
	During the 3 day period, is the generator continuing to compl with respect to the excess waste?  Yes  Yes	No	N/A		
722.134(g)	Note: A generator that generates 1,000 kilograms or great also generates wastewater treatment sludges from edescription for the hazardous waste code F006 may conditions of 722.134(g), (h), or (i) are fulfilled.	lectroplating operatio	ns that meet the listing		
	SUBPART D: RECORDKEEPING AND REPOR	TING			
722.140(a)	Section 722.140 Recordkeeping  Has the generator retained for a period of 3 years:  - a copy of each signed manifest?	./			
	Yes	No	N/A	722.140(a)	
722.140(b)	Has the generator retained a copy of each Annual Report and years from the due date of the report (March 1)?				
	Yes_ U	No	N/A	722.140(b)	
722.140(c)	Has the generator retained for a period of 3 years: - copies of test results, waste analyses or other determ 722.111?	ginations made in acco	ordance with Section		
	Yes	No	N/A	722.140(c)	
722.140(d)	Does a generator who is involved in any unresolved enforcer continue to maintain the records required in subsections a) a	nd c)?	. /		
	Yes		N/A	722.140(d)	

	•	·			
•					
				•	
				~	
	•				
•					
		•			
			•		
				•	•
	·	-			•
	•				
			•		
				•	
		•		•	
*				•	
			·		
			I		
		4			
					•
			•		
•	•				

Location Address: 77 West Chicago Avenue U.S. EPA Inspector: Graciela Scambiatterra **EPA ID Number:** ILD 045 304 367

Regulation	RCRA GENERATOR INSPECTION CHECKLIST (PART 722)	Violation
722.141(a)	Section 722.141 Annual Reporting  Has the generator who ships hazardous waste off-site for treatment, storage or disposal filed an annual report with the Agency by March 1 for the preceding calendar year?  Yes No N/A  Note: If "No", or if deficiencies are noted with the annual report reviewed, contact the Planning and	722.141(a)
722.14 <b>l</b> (b)	Reporting Section.  Has the generator who treats, stores or disposes of hazardous waste on-site, filed an annual report with the Agency by March 1 for the preceding calendar year?  Yes	
722.142(a)(I)	Section 722.142 Exception Reporting  If the generator has not received a copy of the manifest from the TSD facility within 35 days of the date of delivery to the transporter, has the generator contacted the transporter or the TSD facility to determine the status of the hazardous waste?  Yes	722.141(b) 722.142(a)(1)
722.142(a)(2)	If the generator has not received a copy of the signed manifest within 45 days of the date of delivery to the transporter, has he filed an exception report with the Agency in accordance with the requirements of this Section?  Yes No N/A	722.142(a)(2)
722.143	Section 722.143 Additional Reporting Has the generator furnished additional reports as required by the Director?  YesNoN/A	722.143
722.150	SUBPART E: EXPORTS OF HAZARDOUS WASTE  Is the generator an exporter of hazardous waste?  Yes No N/A  If "Yes", has the generator complied with the requirements of Subpart E?  Yes No N/A	722.150
722.160	SUBPART F: IMPORTS OF HAZARDOUS WASTE  Is the generator an importer of hazardous waste?  Yes No N/A  If "Yes", has the generator complied with the requirements of Subpart F?  Yes No N/A	722.160
722.170	SUBPART G: FARMERS  Is the generator a farmer?  Yes No N/A  If "Yes", has the generator complied with the requirements of Subpart G?  Yes No N/A	722.170



Attachment 3
Chicago Tribune- Freedom Center
RCRA ID: ILD 045 304 367 July 16, 2014

## Documents received during the inspection:

Hazardous and non-hazardous waste tracking documents for years 2011 - 2014 (7 pages)	No

			•		
•					
				,	
		4		,	
					•
	•			•	
					•
		*			
	:				•
	•			•	
		·			
	,	•			
			•		
					•
•					
•	•				
		•			
					•
	•				